


LAND CORNER RECORD


Index: V-5	Corner: Section Corner common with 29,30,31 & 32			State of Indiana - Hoosier National Forest	
Section: 29, 30, 31, 32	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe	
Coordinate:	Lat./N:	Lon./E:		Datum:	

CORNER HISTORY: (Chronological history of corner)						
1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:	
April 11, 1973	H. Deaton	STONE	USFS Record			
Reference Objects:	Species:	Diameter:	Bearing:	Distance:		
	Shag. Hickory	12"	South	1.5'		
	Sassafras	4"	N 65° W	14.1'		
	Twin R. Oak	8"	N 55° E	3.8'		
	R. Oak	7"	S 22° E	20.3'		
	Sign Post	4"x4"	N 72° W	4.1'		
Monument Found:	Replaced stone w/ 2" I.D. pipe w/ 3" brass tablet.					
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:			
October 5, 1990	K. Anderson	IP w/ brass cap	BK 155 PG 526, Monroe Co.			
Reference Objects:	Species:	Diameter:	Bearing:	Distance:		
	Shag. Hickory	12"	S 03° W	1.5'		
	Sassafras	6"	N 67° W	14.1'		
	R. Oak	8"	S 22° E	20.2'		
	Sign Post	4"x4"	N 70° W	4.1'		
Evidence Found:						
Monument Found:	3" dia. steel pipe with a 3" brass disk, 1.0' above grade.					

ACCESSORIES: Bearing and distance from monument to witness object

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Twin R. Oak	12"	N 58° E	3.56'
	Shag Bark Hickory	13"	S 03° W	1.45'
	R. Oak	9-1/2"	S 20° E	20.68'
Monument Found or Set:		Found 3" dia. steel pipe with a 3" brass disk, 1.0' above grade.		

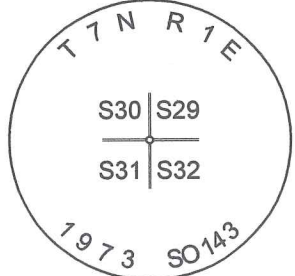MONUMENT SKETCH	NARRATIVE REFERENCE:
	The monument is a 3" dia. steel pipe with a 3" brass disk, 1.0' above grade, located about 1/2 way up westerly facing slope and approximately 60' east of a steep ravine. There is a gravel drive 110' east of corner.

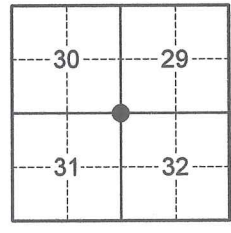SECTION DIAGRAM	PERPETUATION RECORD:
 Corner Location = ●	Monument was found undisturbed per the 1990 Land Corner Record. Two existing bearing tree were remarked. Established one new bearing tree.
Section: 29, 30, 31, 32	Prepared By: BRG #7308 Date: 12/27/2012

Approved by SRB 2-26-2013

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 31

Township: 7 North

Range: 1 East



Corner ID: Polk E-21

Monument Description & Remarks: 3" Brass Disk stamped, "S.30/S.29, S.31/S.32, 1970 SO143".

Survey Sign 4ft above ground at pt. C

References On File: Andrew J. Sobiech description of monument, Certified Land Corner Restoration (1973), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 42 Page No. 30

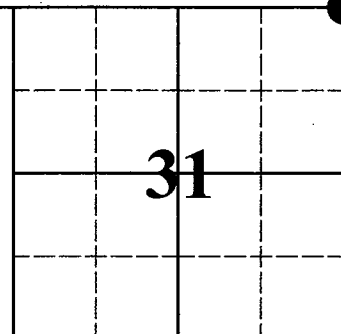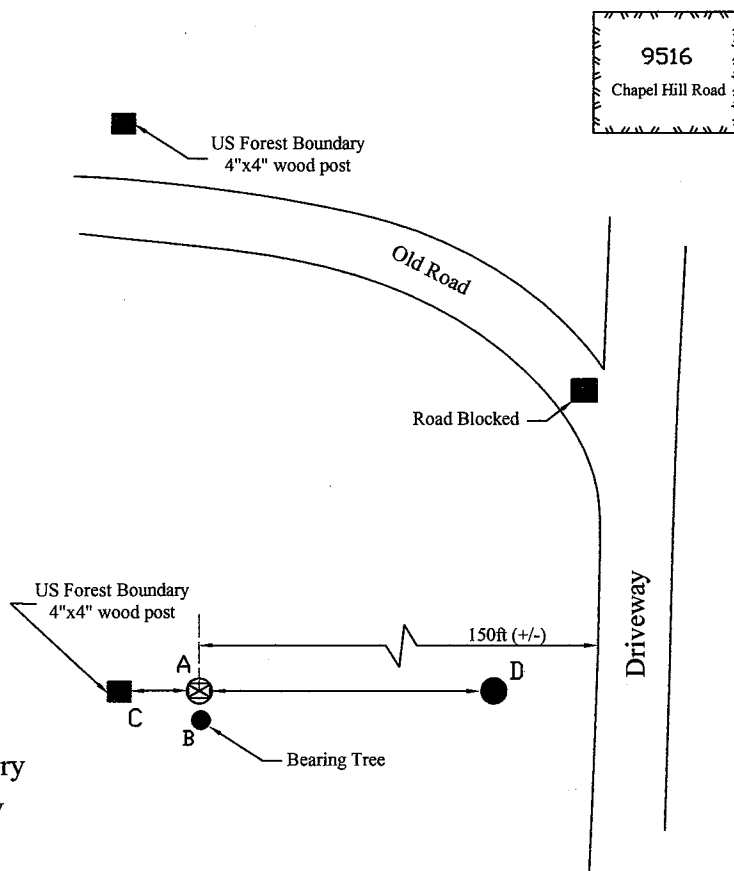

- A - 3" Brass Disk stamped
- B - S 10° W 0.75' to MAG nail in 14" Shagbark Hickory
- C - N 68° E 3.90' to Survey Sign on 4"x4" wood post
- D - S 86° E 24.85' to MAG nail in 11" White Oak

Not To Scale
Compass Bearing Magnetic North



I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 19th day of March, 2009.

Kevin P. Enright

Administered by the Monroe County Surveyor Review Board

Date: 4-7-2009



POLK-521

Index No V-5 LAND CORNER RECORD FSM 7150
T. 7N R. 1E 2nd P.Mer. County Monroe State of Indiana
Section Corner common to Sections 29-30-31-32 Hoosier National Forest

EXISTING SURVEYS


Original Government Survey				Original Survey evidence Found			
Year Surveyed	<u>1814</u>	By	<u>A. Hewie</u>	Date of Search	<u>10/1990</u>	By	<u>K. Anderson</u>
Original Monument	<u>Wood Post</u>			Monument Found	<u>None</u>		
Species	Dia	Bearing	Dist	Orig. Species	Dia	Bearing	Dist
BT's <u>W. Oak</u>	<u>10"</u>	<u>S44E</u>	<u>20 LKS</u>	BT's <u>Stump hole</u>	<u>5.39E</u>	<u>14.1 Ft.</u>	
<u>B. Oak</u>	<u>20"</u>	<u>N36W</u>	<u>30 LKS</u>	Found	<u>No evidence found</u>		

Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found			
Date Surveyed	<u>1860</u>	By	<u>J.S. Buskirk</u>	Date of Search	<u>10/1990</u>	By	<u>Ken Anderson</u>
Where Filed or recorded:	<u>Monroe</u>			Monument Found	<u>A "stone" 3" X 10" X 13"</u>		
Book:	<u>2</u>	Page	<u>28</u>	<u>was at corner point (replaced by iron pipe monument - see below) previously. It may have been set by Buskirk</u>			
Monument Set	<u>Does Not Say</u>			Species	Dia	Bearing	Dist
BT's Species	Dia	Bearing	Dist	BT's	<u>Stump hole - see above</u>		
Ref. <u>W. Oak</u>	<u>15"</u>	<u>S44E</u>	<u>20 LKS</u>	Found	<u>No evidence found</u>		
Obj. <u>W. Oak</u>	<u>8"</u>	<u>N62E</u>	<u>40 LKS</u>				

Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found			
Date Surveyed	<u>4/1973</u>	By	<u>A. Sabiech</u>	Date of Search	<u>10/1990</u>	By	<u>K. Anderson</u>
Where Filed or recorded:	<u>Monroe</u>			Monument Found	<u>Iron pipe 3 ft long 2" I.D. filled w/ concrete, w/ brass cap 3" stamped to identify corner. Cap is 12" mt of ground cap is loose, but attached. Corner stone lying loose on ground</u>		
Book:	<u>155</u>	Page	<u>525</u>	<u>County Miscell. Records</u>			
Monument Set	<u>Iron pipe w/ 3" brass cap</u>			Species	Dia	Bearing	Dist
BT's Species	Dia	Bearing	Dist	BT's	<u>Stump hole</u>		
Ref. <u>Shagbark Hickory</u>	<u>12"</u>	<u>S30W</u>	<u>1.5 Ft</u>	Found	<u>Stump hole</u>		
Obj. <u>Sassafras</u>	<u>4"</u>	<u>N65W</u>	<u>14.1 Ft</u>				
<u>W. Oak</u>	<u>8"</u>	<u>N55E</u>	<u>3.9 Ft</u>				
<u>R. Oak</u>	<u>7"</u>	<u>S22E</u>	<u>20.2 Ft</u>				

OTHER EVIDENCE


Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc: Other Subsequent corner information, by inference, is found in Volume 2, pages 350 and 418, 1881 & 1885, M. H. Buskirk. See also, 1972 corner card by H. Deaton, he found stone 8" above ground & FS location poster dtd 8-22-49 with note that road is 1.69 East Monument is on westerly slope 110 ft west of old road and 60 ft East of road of steep drain in brushy timber

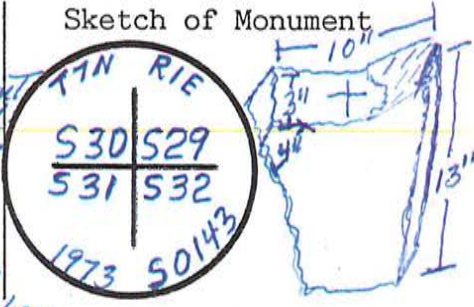

PERPETUATION RECORD

Monument: Describe new monument set, or work done to preserve existing monument.

Iron pipe mon. w/ 3" brass cap was left in found. old stone is loose on top of ground in collar of stones around pipe. 1973 BT's were used but date updated.

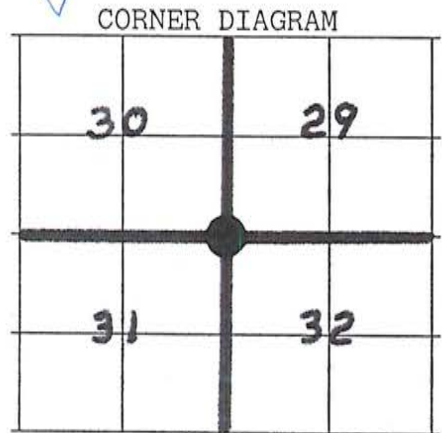

Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

Species	Dia	Bearing	Dist	Notes
<u>Shagbark Hickory</u>	<u>12"</u>	<u>S30W</u>	<u>1.5 Ft</u>	<u>signed</u>
<u>Hickory</u>	<u>6"</u>	<u>N67W</u>	<u>14.1 Ft</u>	<u>signed</u>
<u>W. Oak</u>	<u>8"</u>	<u>N55E</u>	<u>3.9 Ft</u>	<u>signed</u>
<u>R. Oak</u>	<u>7"</u>	<u>S22E</u>	<u>20.2 Ft</u>	<u>signed</u>

Photo Identified Yes
Photo # 284-254
Strip/Series 29/1984
Pinpricked Yes
Search Hours 1 minute

Corner Recordation Yes
Certificate prepared: No
Filed or recorded in County Monroe
Records: Date: March 18, 1985
Book: 155 Page: 526

Corner Record by: Kenneth W. Anderson Date: 10/5/90

MONUMENT RECORD



STATE OF INDIANA - COUNTY OF MONROE

SECTION 29,30,31,32, TOWNSHIP 7 NORTH, RANGE 1 EAST

MONUMENT DESCRIPTION & REMARKS

REPLACED THE STONE WITH A 2" I.D. BY 3' LONG CONCRETE FILLED
GALVANIZED IRON PIPE, CAPPED WITH A 3" DIAMETER GRASS TABLET
STAMPED TO IDENTIFY THE CORNER.

RECOVERY TIE DRAWING

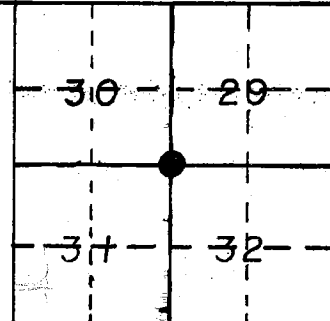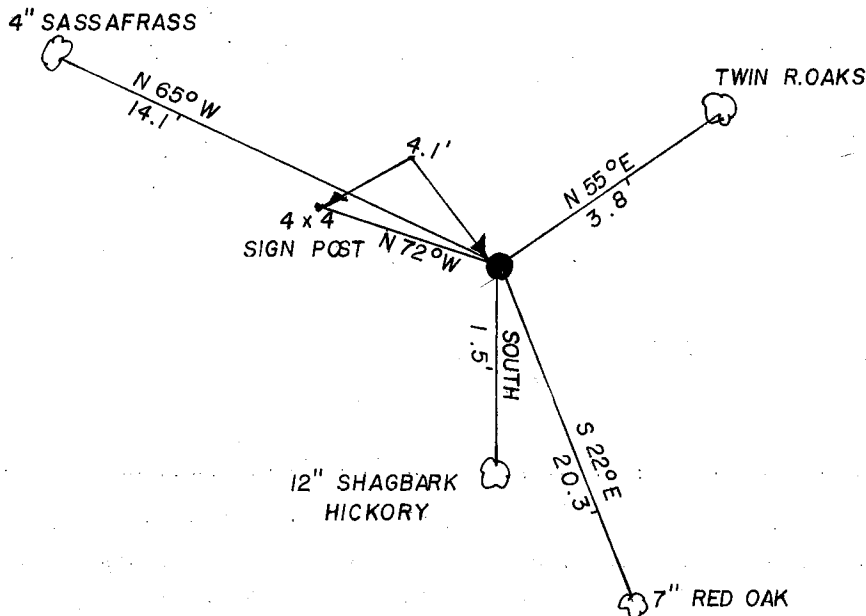

(●) AT CORNER



NOT TO SCALE

STATE OF INDIANA

COUNTY OF MONROE

I, ANDREW J. SOBIECH HEREBY CERTIFY THAT THIS
DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE
WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF
THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND
THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL
THIS 11 DAY OF APRIL, 19 75 A.D.

SPACE
RESERVED
FOR
RECORDING
OFFICER.INDIANA REGISTERED LAND SURVEYOR NO. S-0143

OR

UNITED STATES GOVERNMENT AGENCY

TOWNSHIP:

POLK

CORNER I.D.

E - 21

TITLE

CERTIFIED LAND CORNER RESTORATION

State of Indiana }
County of Monroe } ss.

[E-21]

I, Andrew J. Sobiech, do hereby certify that on the 11th day of April, 1973, I found evidence of the Section corner of Section 29, 30, 31, 32 Township 7 North, Range 1 East, Second Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Original monument was a wood post set in 1814.

Original bearing trees:

W. Oak	B. Oak	No evidence of original survey found.
10"	20"	
S 44° E	N 36° W	No records of subsequent surveys.
20 lks	30 lks	

Description of corner evidence found:


Found 6"x3" c 1½' long stone marked with a + on top, 8" above the surface. Found a marker post set by the C.C.C. on the section line at the edge of a dirt road. The Forest Service notes dated 8-22-49 stated the dirt road is 1.64 chains east of corner, this was measured and proven to be correct. A forest Service Location Poster dated 8-22-49 was nailed to the tree above the stone.

Description of monument and accessories I established to perpetuate the original location of this corner:

I replaced the stone with a 2" I.D. by 3 ft. long concrete filled, galvanized iron pipe, capped with a 3 inch diameter grass tablet stamped to identify the corner. I established the following witnesses:

Shagbark Hickory	Sign Post	Sassafrass	Twin R. Oaks	Red Oak
12"	4 x 4	4"	Bring to East Branch	7"
South	N 72° W	N 65° W	8"	S 22° E
1.5'	4.1'	14.1'	N 55° E	20.3'
			3.8'	

Laid old stone on top of ground next to new monument.

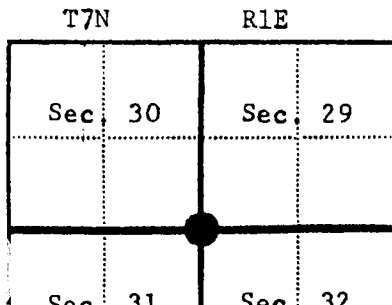

Field Assistant Henry Deaton, U.S.F.S.
~~Resident witnesses~~
Dated at Brownstown Indiana, this 11th day of April 19 73.
Signature Andrew J. Sobiech Title R.L.S.
(County Surveyor, Registered Land Surveyor, or other duly authorized official)
Surveyors Registration No. S-0143

Index No. V-5
(Alphabetical-Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

POIK E21
R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. N.F. Noosier County Monroe State Ind
Section 30 Corner common to sections 30 29 31 and 32

EXISTING SURVEYS

Original Government Survey

Year surveyed 1814

Original monument Wood Post
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	Diameter	Bearing	Distance
<u>4. Oak</u>	<u>20"</u>	<u>S44E</u>	<u>20 ks</u>
<u>B. Oak</u>	<u>20"</u>	<u>N36W</u>	<u>30 ks</u>

Original Evidence Found

Year of search 1972 By H. Decker, B. Hyman

Monument found No

Original Bearing Trees Found

Species	Diameter	Bearing	Distance

Subsequent Corner Restoration

Year surveyed _____ By _____

Where filed or recorded _____

Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance


Evidence of Subsequent Corner Restoration Found

Year of search 1972 By H. Decker, B. Hyman

Monument found No

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance

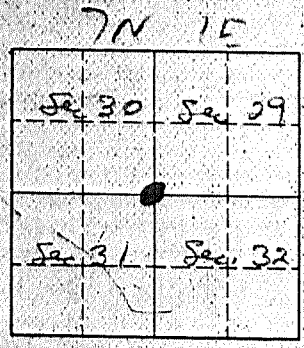

Sketch
O Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any.

(From Forest Service notes)

Dirt road 15' 169 ch west of corner

(D. 6 measure distance, but it checked)

- At time of search:
1. Did you have the record description?
Yes ☒ No ☐
 2. How was search area located?
Pacing, chaining, photos, maps,
etc. photo maps F.S. marker
post at road F.S. location
post at stone
 3. Man hours spent in search 2 hours
 4. Do you think additional search might recover evidence? Yes ☐ No ☒

Perpetuation Record

Monument and accessories established. Include brief description of area.

5. Signature J. Deaton

Certified corner restoration certificate prepared: Yes ☐ No ☐

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____